


**Environmental Measurements
Hingham High School
17 Union St
Hingham, MA**

08/23/2021

PREPARED FOR:
Doug Foley
Facility Manager
Hingham, MA

PREPARED BY:
ENVIROTEST LAB, INC.
639 WASHINGTON STREET
DEDHAM, MA 02026
781-329-1133

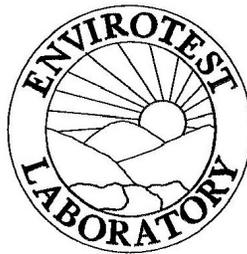

Air Quality Measurements - 1

Contact etestpaula@gmail.com for an email version of this report

Enclosed are the results for the preliminary environmental inspection conducted on August 23, 2021. On this day, environmental sampling, analysis and investigations were performed to determine the levels and conditions of the following: Carbon Dioxide, Carbon Monoxide, Microbial Volatile Organic Compounds (MVOCs), Humidity, Airborne Particulate, Temperature, Thermal Imagery identifiable issues, Moisture levels in building materials, Air Exchange, Visible Mold and Airborne Mold levels.

This report is written in sections where testing is described in detailed with specific reasons and methods explained. Envirotest recommends becoming familiar with the Test Parameters and **then** proceed to the Observation/Conclusion (Section A and B) of this report located below.

Numerical Results are located following each Test Parameter Section.

A. Observation

The entire school was inspected to determine air quality while occupied.

Air Quality throughout the school was found to be excellent in all areas analyzed.

The weather during the inspection was clear and about 84 degrees Fahrenheit at the beginning of the inspection.

Envirotest performed an environmental and air quality inspection to determine issues which could affect the building structure and the occupant's health.

From the testing performed, Envirotest has determined that at the time of the inspection, visual results and sampling indicate the following:

For the purposes of this report “North” as a direction is the front street facing door and NOT magnetic North

1. At the time of the inspection, there were no identified qualitative or quantitative problematic environmental issues which need to be addressed or remediated.

B. Conclusion

Envirotest recommends the following be performed to mitigate the situation(s) listed in section A. Immediate issues of concern should be dealt with sequentially as follows:

Suggestions for this specific Building:

1. At the time of the inspection there were no qualitative or quantitative air quality issues identified which need to be addressed or remediated.

Analysis Performed:

Air Quality Measurements - 2

I. Temperature (°F)

Area	Temperature (°F)	Area	Temperature (°F)
Main Office Areas	75	Rooms 157, 159, 160, 163 and 165	73 - 77
Rooms 120 - 129	74 - 77	Cafeteria	76
Rooms 130 - 135	75 - 78	Rooms 220 - 229	76 - 79
Rooms 180, 182, 184, 186	76 - 78	Rooms 211 - 217	75 - 78
Rooms 191, 193 and 197	74 - 76	Rooms 280 - 292	76 - 78
Auditorium	77	Rooms 294 and 296	77 - 79
Rooms 170 - 179	76 - 78	Rooms 298 and 299	77 - 78
Gymnasium	78	Library	76
		Outside Levels	84

Temperature levels were found to be normal in all areas sampled.

II. Carbon Dioxide (CO₂)

Area	CO ₂ CONCENTRATION (PPMv)	Area	CO ₂ CONCENTRATION (PPMv)
Main Office Areas	412	Rooms 157, 159, 160, 163 and 165	407
Rooms 120 - 129	416	Cafeteria	406
Rooms 130 - 135	418	Rooms 220 - 229	421
Rooms 180, 182, 184, 186	417	Rooms 211 - 217	407
Rooms 191, 193 and 197	416	Rooms 280 - 292	409
Auditorium	408	Rooms 294 and 296	410
Rooms 170 - 179	405	Rooms 298 and 299	408
Gymnasium	407	Library	408
		Outside Levels	401

Carbon Dioxide levels were found to be normal in all areas sampled.

III. Carbon Monoxide (CO)

Area	CO CONCENTRATION (PPMv)	Area	CO CONCENTRATION (PPMv)
Main Office Areas	0	Rooms 157, 159, 160, 163 and 165	0
Rooms 120 - 129	0	Cafeteria	0
Rooms 130 - 135	0	Rooms 220 - 229	0
Rooms 180, 182, 184, 186	0	Rooms 211 - 217	0
Rooms 191, 193 and 197	0	Rooms 280 - 292	0
Auditorium	0	Rooms 294 and 296	0
Rooms 170 - 179	0	Rooms 298 and 299	0
Gymnasium	0	Library	0
		Outside Levels	0

Carbon Monoxide was found to be normal in all areas sampled.

IV. Volatile Organic Compounds (VOCs)

Area	VOC CONCENTRATION (ppb)	Area	VOC CONCENTRATION (ppb)
Main Office Areas	0	Rooms 157, 159, 160, 163 and 165	0
Rooms 120 - 129	0	Cafeteria	0
Rooms 130 - 135	0	Rooms 220 - 229	0
Rooms 180, 182, 184, 186	0	Rooms 211 - 217	0
Rooms 191, 193 and 197	0	Rooms 280 - 292	0
Auditorium	0	Rooms 294 and 296	0
Rooms 170 - 179	0	Rooms 298 and 299	0
Gymnasium	0	Library	0
		Outside Levels	0

VOC levels were found to be normal in all areas sampled.

V. Humidity (%)

Area	Relative Humidity (%)	Area	Relative Humidity (%)
Main Office Areas	56	Rooms 157, 159, 160, 163 and 165	56
Rooms 120 - 129	57	Cafeteria	56
Rooms 130 - 135	56	Rooms 220 - 229	56
Rooms 180, 182, 184, 186	56	Rooms 211 - 217	56
Rooms 191, 193 and 197	57	Rooms 280 - 292	56
Auditorium	56	Rooms 294 and 296	56
Rooms 170 - 179	56	Rooms 298 and 299	56
Gymnasium	56	Library	57
		Outside Levels	58

The results indicate humidity levels were normal in all areas sampled.

VI. Ultrafine Particulate Levels (p/cc)

Area	Particulate Levels (p/cc)	Area	Particulate Levels (p/cc)
Main Office Areas	1286	Rooms 157, 159, 160, 163 and 165	1477
Rooms 120 - 129	1386	Cafeteria	1283
Rooms 130 - 135	1768	Rooms 220 - 229	1424
Rooms 180, 182, 184, 186	1426	Rooms 211 - 217	1285
Rooms 191, 193 and 197	1549	Rooms 280 - 292	1298
Auditorium	1972	Rooms 294 and 296	1657
Rooms 170 - 179	1425	Rooms 298 and 299	1328
Gymnasium	1527	Library	1096
		Outside Levels	3195

Airborne particulate was found to be normal in all areas sampled.

VII. Particulate Levels ($\mu\text{g}/\text{m}^3$)

Area	Particulate ($\mu\text{g}/\text{m}^3$)	Area	Particulate ($\mu\text{g}/\text{m}^3$)
Main Office Areas	0.01	Rooms 157, 159, 160, 163 and 165	0.01
Rooms 120 - 129	0.01	Cafeteria	0.01
Rooms 130 - 135	0.01	Rooms 220 - 229	0.01
Rooms 180, 182, 184, 186	0.01	Rooms 211 - 217	0.01
Rooms 191, 193 and 197	0.01	Rooms 280 - 292	0.01
Auditorium	0.01	Rooms 294 and 296	0.01
Rooms 170 - 179	0.01	Rooms 298 and 299	0.01
Gymnasium	0.01	Library	0.01
Rooms 191, 193 and 197	0.01	Rooms 300 - 314	0.01
		Outside Levels	0.01

Airborne particulate was found to be normal in all areas tested.

VIII. Average Air Movement Per Area

Area	Air Movement (Exchanges/Per Hour)	Area	Air Movement (Exchanges/Per Hour)
Main Office Areas	4.7	Rooms 157, 159, 160, 163 and 165	4.6
Rooms 120 - 129	4.8	Cafeteria	5.4
Rooms 130 - 135	4.9	Rooms 220 - 229	4.6
Rooms 180, 182, 184, 186	4.7	Rooms 211 - 217	4.5
Rooms 191, 193 and 197	4.5	Rooms 280 - 292	4.6
Auditorium	4.7	Rooms 294 and 296	4.4
Rooms 170 - 179	4.6	Rooms 298 and 299	4.5
Gymnasium	4.7	Library	5.0
Rooms 191, 193 and 197	4.8	Rooms 300 - 314	4.1

Air Movement was found to be acceptable in all areas tested.

The following is an explanation of each parameter analyzed. All numbers correspond to analysis taken above.

I. Carbon Dioxide (CO₂)

Carbon Dioxide levels were analyzed using a TSI Q-Track Plus 8554 Air Quality Monitor with a data logger. CO₂ measurements were recorded by the data logger at marked intervals over the course of the monitoring period.. The TSI Q-Track Plus 8554 Air Quality Monitor uses an infrared sensor to analyze for CO₂. The CO₂ System was calibrated to NIST certified CO₂ standards before and after the monitoring period.

As a point of reference, ASHRAE¹ recommends levels of 1000 PPMv of CO₂ as the acceptable indoor limit¹. This value (1000 ppm) corresponds to approximately 15 cubic feet per minute of outside air per person supplied to occupied spaces.

Carbon dioxide is a non-toxic gas. It has beneficial uses and is the "fizz" in carbonated beverages. When frozen, it is "dry ice". At concentrations from of 1,100 ppm to 5,000 ppm carbon dioxide can cause headaches. At extremely high levels of 100,000 ppm (10 percent) people lose consciousness in ten minutes, and at 200,000 ppm (20 percent) CO₂ causes partial or complete closure of the glottis.

Levels of 2,500 to 5,000 ppm do not normally occur in structures. Use of any type of non-vented fuel-burning space heater, such as a kerosene, natural gas, or propane heater will result in elevated levels. High levels also can occur when several people are in a poorly ventilated room. Carbon dioxide is commonly used as an indicator of the adequacy of ventilation systems. When the windows and doors are closed, all buildings need ventilation both summer and winter.

In buildings, the normally occurring leaks and cracks around windows and doors typically provide this ventilation. New, energy-efficient houses are now so tight that most leaks have been eliminated and some type of ventilation system may be needed.

In commercial buildings the required ventilation is typically provided by a fresh air intake to the heating and cooling system. Unfortunately, many firms have closed the fresh air intake to save energy. Many other systems were installed without fresh air intakes. In older buildings many fresh air exchangers and intakes may either be not working or in need of repair.

The American Society of Heating Refrigerating and Air-Conditioning Engineers, Inc. publishes "ASHRAE Standard 62-1989, Ventilation for Acceptable Indoor Air Quality." This standard specifies that the minimum ventilation rate per person is 15 cubic feet per minute (cfm) of outdoor air. Higher rates are in place for specified applications, i.e., 20 cfm for a school training shop, and 30 cfm for a hospital operating room. Residential dwellings are covered by a special specification, which is 0.35 air changes per hour, but not less than 15 cfm/person. (Note, additional special requirements are listed in the ASHRAE Standard and the complete standard should be consulted for specific recommendations.)

Since carbon dioxide is produced by human respiration, the amount of carbon dioxide can be easily used as an indicator of the adequacy of fresh air ventilation in occupied buildings. Outdoor levels are

approximately 400 ppm. The ASHRAE standard requires that sufficient fresh air be provided to keep the level below 1,000 ppm. The CO₂ levels in buildings with sufficient ventilation will range between these two readings.

Buildings with insufficient ventilation will range from 1,000 ppm up. Often the levels will be low in the morning and increase while the building is occupied. In buildings occupied during the day the reading should be taken in mid-afternoon, because this is when the CO₂ reaches its highest level.

High levels of carbon dioxide often indicate inadequate ventilation. Persons in buildings with high CO₂ levels may complain of burning eyes, tiredness, and headaches. These symptoms can be caused by a combination of carbon dioxide and the many other pollutants that occur in a poorly ventilated space.

When too little outdoor air enters a building, pollutants can accumulate to levels that can pose health and comfort problems. Unless special mechanical means of ventilation are designed and constructed into a building to minimize the amount of outdoor air that can "leak" into and out of the building, these buildings may have higher pollutant levels. .

Outdoor air enters and leaves buildings by: infiltration, natural ventilation, and mechanical ventilation. In a process known as infiltration, outdoor air flows into the house through openings, joints, and cracks in walls, floors, and ceilings, and around windows and doors. In natural ventilation, air moves through opened windows and doors. Air movement associated with infiltration and natural ventilation is caused by air temperature differences between indoors and outdoors and by wind.

There are a number of mechanical ventilation devices, from outdoor-vented fans that intermittently remove air from a single room (bathroom vents) to air handling systems that use fans and duct work to continuously remove indoor air and distribute filtered and conditioned outdoor air to strategic points throughout the house. The rate at which outdoor air replaces indoor air is described as the air exchange rate. When there is little infiltration, natural ventilation, or mechanical ventilation, the air exchange rate is low and pollutant levels can increase.

¹ ASHRAE Standard 62-1989(1989), "Ventilation for Acceptable Indoor Air Quality"
American Society of Heating, Refrigeration, and Air Conditioning Engineers, Inc., Atlanta, Georgia.

II. Carbon Monoxide (CO)

The TSI Q-Track Plus 8554 Air Quality Monitor equipped with a datalogger for CO was used to monitor for CO. The TSI Q-Track Plus 8554 uses an electrochemical sensor to analyze for CO. This instrument was calibrated prior to all uses with outside air and daily by utilizing a 100 ppm CO span gas prior to use. Calibration is performed against a known standard to ensure precision and accuracy. Measurements were taken at marked intervals for the duration of the survey.

Carbon Monoxide is odorless, colorless, and highly toxic. It kills by reducing the oxygen supply in the body and is a deadly poison. It adversely affects human health at only a few parts per million and causes death at 250 parts per million (250 ppm). CO produces its toxic effect by competing with oxygen for hemoglobin molecules in the blood. Since it has a greater affinity for hemoglobin than

does oxygen, CO is more readily accepted into the blood stream. Low amounts of CO can cause headaches, while higher levels can be fatal.

Properly installed and maintained heating appliances cause little threat from carbon monoxide. Poorly installed and maintained systems can be deadly. All fossil fuels contain carbon. During the combustion process the carbon in the fuel combines with oxygen in the air. With sufficient oxygen, sufficient turbulence, and at high ignition temperatures, nearly all of the carbon combines with two atoms of oxygen, producing the relatively innocuous carbon dioxide.

Heating appliances are designed to provide excess oxygen, and a clean, properly installed and maintained system will produce primarily carbon dioxide (CO₂), a large amount of water vapor, small amounts of carbon monoxide (CO), and a number of other pollutants. These products of combustion from a properly maintained heating system will be vented outdoors through the chimney, and do not pose an undue risk to the building occupants.

When insufficient oxygen is available for complete combustion, one atom of carbon combines with one atom of oxygen and carbon monoxide is produced. If the heating appliance or the venting system is defective, some or all of the carbon monoxide might be circulated into the building, posing an extremely hazardous health risk. A warning sign of heating trouble might be sudden excessive levels of moisture in the building, since water vapor is also produced by combustion of fossil fuels. CO is also a by-product of tobacco smoke and motor vehicle exhaust.

III. Volatile Organic Compounds (VOCs)

Volatile Organic Compounds (VOCs) were tested with the use of the PpbRae. The PpbRae is the most sensitive hand held VOC monitor available. This machine measures with true parts per billion detection of extremely low level, low vapor pressure and highly toxic VOCs, like paint fumes, rug off-gassing, pesticide residues and isocyanates (polyurethane foam, insulation materials, surface coatings, car seats, furniture, foam mattresses, under-carpet padding, packaging materials, shoes, laminated fabrics, polyurethane rubber, and adhesives, and during the thermal degradation of polyurethane products.) This instrument senses measurements of off-gassing from carpets and fabrics, spot checks for ethylene oxide and formaldehyde.

At room temperature, volatile organic compounds (VOCs) are emitted as gases from certain solids or liquids. These include pesticides, solvents, fuels, plastics, perfumes, cleaning agents, hair sprays, rugs, oven cleaners, dry-cleaning fluids, building furnishings, office materials like copiers, certain printers, correction fluids, graphics and craft materials etc. VOCs are consistently found at higher levels indoors than outdoors. Products used in building, office, school, arts/crafts and hobby activities emit a wide array of VOCs. Pesticides sold for household use are technically classified as semi-volatile organic compounds. Very low airborne levels of these products have been found to cause symptoms like conjunctival irritation, nose and throat irritation, headache, allergic skin reaction, and nausea to sensitive individuals.

The sensor in this instrument is also very helpful in determining the origination of mold in buildings by sensing the microbial volatile organic compounds (mVOCs) in the air.

IV. Percent Relative Humidity (RH)

The TSI Q-Track Plus 8554 Air Quality Monitor and the TSI VELOCICALC air quality meter indicates % Relative Humidity.

a. Relative Humidity

Everyone is familiar with the word "humidity," especially as it applies to one's comfort indoors or outdoors. We can feel the humidity on the hot, sticky days of summer, and we know it is low when static electricity shocks us during cold, dry winters. But few people understand the science behind humidity or what is meant by the more precise term "relative humidity."

The National Oceanic and Atmospheric Administration (NOAA) defines relative humidity as: "A dimensionless ratio, expressed in percent (% RH), of the amount of atmospheric moisture present relative to the amount that would be present if the air were saturated. Since the latter amount is dependent on temperature, relative humidity is a function of both moisture content and temperature. As such, relative humidity by itself does not directly indicate the actual amount of atmospheric moisture present."

For example, if the air contains half as much water vapor as is possible, then the relative humidity reading would be 50% RH. Bear in mind that the warmer the air temperature, the more moisture it can hold, and vice versa. This is an important factor to remember when looking at a particular RH. Using the same example, there is less water vapor at 50% RH (65 \oplus) than 50% RH (85 \oplus). Almost every meteorologist and hygrometer expresses humidity in this fashion.

b. Humidity and Comfort

Our comfort, whether we feel warm or cold, is determined, among other factors, by the rate at which moisture is evaporated from our bodies. It is this fact which makes the humid summer day so uncomfortable. When there is already so much moisture in the air that the moisture from our skin evaporates very slowly. Therefore, as we perspire, we feel sticky and are generally uncomfortable. Conversely, if the air is dry, evaporation is much more rapid; the more rapid the evaporation, the cooler we feel.

c. Humidity and Health

Air has a tremendous need for moisture. So when we heat our buildings in the winter (drawing in cold, dry air), this air is going to take moisture from wherever it can. This dry air in our buildings and offices not only dries our skin, but also robs the delicate membranes of the nose and throat of their normal moisture. Low humidity may make us more uncomfortable or even subject to various respiratory problems.

However, there may be more effects of both high and low humidity than just discomfort. Studies show that humidity may affect three groups of factors with respect to health:

1. Biological contaminants including bacteria, viruses, fungi, and mites.
2. Pathogens causing respiratory problems including allergic rhinitis and asthma.

3. Chemical interactions including ozone production.

Some of these factors may thrive at low levels of RH while others may prefer high levels of RH. For example, certain bacteria thrive and grow at very low levels of humidity (0-20% RH) while other bacteria grow and thrive at very high levels of humidity (55%-100% RH). Most Fungi remain dormant and do not start growing and thriving until %RH levels rise above 50% RH.

The optimal comfort zone for %RH is roughly between 35-45% RH in the summer months and 25-40% RH in the winter months. By following these guidelines the levels of bacteria, fungi, viruses, respiratory infections, allergic rhinitis and asthma will be kept in check.

d. Humidity and Energy Costs

In winter, heated, non-humidified air may dry out and/or shrink wood framing around doors and window frames. Gaps may occur allowing cold, dry outside air to enter the building. This heat loss causes heating systems to output more dry air. To maintain a certain humidity level, many people compensate with the use of a humidifier. However, since it takes four times as much energy to heat water than to heat dry air, it costs more to maintain a specific humidity level in your building for health and comfort reasons. Monitoring the humidity and careful attention to areas of heat loss will help offset costs.

The benefit of humidified air is its effect on how we feel in certain temperatures. In the winter, the air is dry and the increased evaporation of moisture from our skin makes us feel cold. While 70°F is recommended for indoor air temperature, some find that the temperature (when dry) must be near 80°F or even higher for us to feel warm enough to be comfortable. The proper humidity will make 70°F feel comfortable and may help offset the increased energy it takes to heat humidified air. However, Envirotest does not recommend humidification of any sort during the winter months due to the inherent problems associated with humidifiers. Typically most humidifiers require excessive amounts of cleaning and can increase the humidity to levels where fungi and bacterial growth will occur. Envirotest recommends re-hydrating by consuming more liquids when humidity drops in the winter.

e. Interior Building Humidity

Low humidity in winter may cause drying and/or shrinking of furniture, wood floors and interior trim. Doors and drawers may warp or crack and glue joints in fine furniture and veneers may open or split. Low humidity may rob plants of their moisture, and it may contribute to wall and ceiling cracks. All of these problems may be the result of dry air absorbing moisture from whatever source it can find inside your building.

Buildup of moisture may also cause rotting of wood, mildew and mold. In areas of your building where humidity may be very high, such as Sub-Grade area, laundry rooms, Attics, or Crawl Spaces, it is important to prevent damage to your building from excessive moisture. Additional ventilation may be helpful in the case of excessive Attic humidity (Please see appendix C.)

V. Temperature

The TSI Q-Track Plus 8554 Air Quality Monitor and the TSI VELOCICALC air quality meter indicates Temperature.

Recommended temperature levels for optimal office comfort should be between 68 and 74 °F for interior comfort conditions. Temperature is an easy and basic indicator of whether the HVAC system is working correctly by indicating if the thermostats are calibrated correctly. In many instances, temperature is taken to determine if an Attic venting system is functioning properly and whether heat is accumulating in the Attic space.

VI. Ultrafine Particulate (p/cc)

Envirotest performed particulate testing to determine the amount of suspended particulate in the environment. Suspended particulate testing is performed utilizing the P-Trak Ultrafine particle counter. The P-Trak detects and counts particles smaller than 0.02 micrometers in diameter. These particles are the ones that often accompany or signal the presence of a pollutant that is the cause of complaints about indoor air quality. Because the P-Trak provides far greater sensitivity to very small particles than traditional instruments, it can actually be used to locate the source and migration of toxic exhaust gases, malfunctioning office equipment, pinhole leaks in heating system gaskets and a wide variety of other problems including airborne mold spores.

Typical Pollutant Sizes	
Bacteria	.01 to 1.0 Microns
Dust	1.0 to 10 Microns
Mold	1.0 to 10 Microns
Hair	10 to 100 Microns
Pollen	10 to 100 Microns
Diesel Particulate	0.1 – 100 Microns

The Following are common sources of airborne articulate. This list in by no means exhaustive, but it gives you an idea of the types of things to be aware of when you are looking for the source of contamination.

Mold	Bacteria
Hair	Combustion Exhaust
Skin Flakes	Dirty Clothing
Cosmetics	Chemicals
Perfumes	Caulks and Paints
Coughing / Sneezing	Aerosols
Excessive Movement	Ions (Rust)
Wood Fibers	Smoke
Paper Fibers	Thinners /Solvents
Tobacco Products	Food
Candles	Incense

Use of scented candles and incense contribute significant quantities of pollutants to the indoor environment, especially soot, benzene and lead. Due to the variability in candles and incense and their respective emission rates, great uncertainty would exist in a generalized risk assessment. The absence of consumer warnings concerning candle emissions and their potential health effects may contribute to exposure of susceptible individuals to respiratory inflammatory agents, carcinogens and teratogens.

Diesel particulate matter as found as a results of burning diesel fuel for heat, is part of a complex mixture that makes up diesel exhaust. Diesel exhaust is commonly found throughout the environment and is estimated by EPA's National Scale Assessment to contribute to the human health risk. Diesel exhaust is composed of two phases, either gas or particle and both phases contribute to the risk. The gas phase is composed of many of the urban hazardous air pollutants, such as acetaldehyde, acrolein, benzene, 1,3-butadiene, formaldehyde and polycyclic aromatic hydrocarbons. The particle phase also has many different types of particles that can be classified by size or composition. The size of diesel particulate that are of greatest health concern are those that are in the categories of fine, and ultra fine particles. The composition of these fine and ultra fine particles may be composed of elemental carbon with adsorbed compounds such as organic compounds, sulfate, nitrate, metals and other trace elements. Diesel exhaust is emitted from a broad range of diesel engines; building heating systems, on road diesel engines of trucks, buses and cars and the off road diesel engines that include locomotives, marine vessels and heavy duty equipment. The most common exposure pathway is breathing the air that contains the diesel particulate matter. The fine and ultra fine particles are respirable which means that they can avoid many of the human respiratory system defense mechanisms and enter deeply into the lung. In the National Scale.

VII. Particulate Sampling P3 dust analysis

Envirotest utilizes the SIDEPAK AM510 Personal Aerosol Monitor analyzing and data logging aerosol concentration in real time. This machine is a belt-mountable laser photometer that allows a wide variety of size-selective aerosol inlet conditioners for breathing zone or area measurements with a respirable cyclone or integrated impactors. The results are given in real-time concentrations (mg/m³). Sensor type: 90° light scattering, 670 nm laser diode

The SIDEPAK has an Aerosol concentration range: 0.001 to 20 mg/m³ and can read particle sizes from 0.1 to 10 micrometer (µm). Envirotest performed testing to determine the levels of P3 (0.3 micrometers) aerosols.

VIII. Moisture Content

Moisture content was performed using a Protimeter Surveymaster SM. This meter measures water content utilizing radio frequency emissions and through two (2) pin electrodes. The results of testing utilizing the measure mode are in a percentage (%) format representing wood moisture equivalent. The test is performed by actually impinging wall material and writing results as the test is taken. This test is necessary when establishing the exact areas of moisture concentration and origination.

IX. Visible Results For Mold

Inspection for visible mold was performed by trained mold professionals observing visible surfaces and inside wall cavities and other small areas with the assistance of a TESTO-318-1 Boroscope. This machine is able to be inserted into walls and allows the user to visibly detect interior wall cavity utilizing fiber-optic technology with the supplied micro-light. Envirotest performs interior wall cavity observations by removing the electrical outlets and switch plate covers and inserting the probe directly into the wall cavity. Upon entrance into the wall cavity, Envirotest is able to observe any clue of mold activity or obvious mold staining of building materials and interior wall components.

X. Thermal Imagery

Envirotest utilizes a Flir Thermacam for thermal imaging or thermography of areas of a building. Thermography is the use of an infrared imaging and measurement camera to "see" and "measure" thermal energy emitted from an object.

Thermal, or infrared energy, is light that is not visible because its wavelength is too long to be detected by the human eye; it's the part of the electromagnetic spectrum that we perceive as heat. Unlike visible light, in the infrared world, everything with a temperature above absolute zero emits heat. Even very cold objects, like ice cubes, emit infrared. The higher the object's temperature, the greater the IR radiation emitted. Infrared allows us to see what our eyes cannot.

Infrared thermography cameras produce images of invisible infrared or "heat" radiation and provide precise non-contact temperature measurement capabilities. Envirotest utilizes this camera to pinpoint areas of varying temperatures to identify leaks under walls, floors and ceilings.

XI. Air Change Per Hour

The TSI Q-Track Plus 8554 Air Quality Monitor and the TSI VELOCICALC air quality meter reads air flow and air exchange.

The minimum ventilation (outdoor air) rates and minimum exhaust rates mandated by code. Most of the modern model codes (Uniform Mechanical Code, International Mechanical Code) refer to ANSI/ASHRAE Standard 62.0-2010 Ventilation for Acceptable Indoor Air Quality as the reference for ventilation rates according to occupancy and type of facility. It is important to note that ventilation is defined as outdoor air.

Air changes per hr (ACH / ACPH) simply describes how many times the quantity of air in a room (or structure) is completely replaced per hour.

If you have a 10'x10'x10' room, the room contains 1000 cubic feet of air. If the supply and return to the room is supplying a balanced 100 cfm (cubic feet per minute) of air to the room you would have $100 \text{ cfm} \times 60 \text{ minutes} = 6,000 \text{ cfh}$ (cubic feet per hour) which would equal 6 air changes per hour ($6,000/1000 = 6$).

Different spaces have different ventilation requirements based on occupancy level (how many people are in the room) and use type (see Table Below)

Suggested Air Changes For Proper Ventilation

Change Per Hour = Cubic feet per hour exhausted/Room Volume

Area Minimum Recommended Air Change Per Hour

Classroom	4 - 6	
Auditorium	3 - 10	
Rooms 191, 193 and 197		3 - 8
Kitchen	1 - 5	
Laboratory	2 - 5	
Office	2 - 8	
Restroom	4 - 7	

**APPENDIX 1
AIR STANDARDS**

Constituent	Standard	Source
Carbon Monoxide	35 ppm 25 ppm 9 ppm	OSHA ACGIH-TLV* NAAQS
Carbon Dioxide	5,000 ppm 1,000 ppm 800 ppm	OSHA-PEL* ACGIH-TLV* ASHRAE MDPH (recommended)
Temperature	68-72 Fahrenheit	
Humidity	25-35%	
Hydrogen Sulfide	20 ppm 10 ppm/10 minutes Over 65 ppm	¹ OSHA Ceiling NIOSH Ceiling Evacuation
Volatile Organic Compounds (VOCs)	35 ppb	Envirotest Comfort
Nitrogen Dioxide	5 ppm 3 ppm	OSHA-PEL* ACGIH-TLV*
Ultrafine Particulate (Average building)	<1,000 - <6,000 p/cc	Envirotest Comfort
Ultrafine Particulate (Average Construction Area)	5,000-30,000 p/cc	Not to exceed results Typically compiled by Envirotest
Nuisance Dust	5 mg/m ³ 3 mg/m ³ 0.3 mg/m ³	OSHA ACGIH ASHRAE

- 1 Maximum concentration for short period (usually between 5 and 30 minutes, each gas is different) usually four such exposures are allowed per day and average exposures must still be within TWA.
- 2 Maximum one-time exposure, usually 10 minutes. No other exposure is allowed even below
- 3 "Threshold Limit Value" for the Time Weighted Average 8 hour day.
- 4 15 minutes "Short Term Exposure Limit" which should not be exceeded at any time during the working day and not be repeated more than four times per day. STELs should exceed three times the TWA for no more than a total of thirty minutes and never more than five times the TWA even if the TWA is never exceeded. there should be at least 60 minutes between STEL exposure periods and TWA should not be exceeded. (ACGIH Standard)
- 5 This is the concentration which could be "immediately dangerous to life or health" and represents the maximum level from which one could safely escape within thirty minutes. (ACGIH Standard)

Appendix

Report Limitations and Disclosure

This report has been produced for Envirotest's client only and is not intended for dissemination outside the Envirotest-Client sphere without written consent from Envirotest personnel. This report is intended only as a general guide to help only Envirotest's client make his/her own evaluation of the overall condition of the

inspected areas. The report expresses the personal opinions of the inspector, based upon his visual impressions of the conditions that existed at the time of the inspection only. The inspection and report are not intended to be technically exhaustive, or to imply that every component was inspected, or that every possible defect was discovered. No disassembly of equipment, moving of furniture, appliances or stored items, or excavation was performed. All components and conditions which by the nature of their location are concealed, camouflaged or difficult to inspect are excluded from the report.

Systems and conditions which are not within the scope of this inspection include, but are not limited to: formaldehyde, lead paint, asbestos, environmental hazards; pest infestation, Outdoor sheds, efficiency measurement of insulation or heating and cooling equipment, internal or underground drainage or plumbing, any systems which are shut down or otherwise secured; water wells (water quality and quantity) zoning ordinances; intercoms; security systems; heat sensors; cosmetics or building code conformity. Any general comments about these systems and conditions are informational only and do not represent an inspection.

The inspection report should not be construed as a compliance inspection of any governmental or non-governmental codes or regulations. The report is not intended to be a warranty or guarantee of the present or future adequacy or performance of the structure, its systems, or their component parts. This report does not constitute any express or implied warranty of merchantability or fitness for use regarding the condition of the property and it should not be relied upon as such. Any opinions expressed regarding adequacy, capacity, or expected life of components are general estimates based on information about similar components and occasional wide variations are to be expected between such estimates and actual experience.

To the best of our knowledge and belief, all statements and information in this report are true and correct.

Payment for this report shall constitute a binding contract that should any disagreement or dispute arise as a result of this inspection or report, it shall be decided by arbitration and shall be submitted for binding, non-appealable arbitration to the American Arbitration Association in accordance with its Construction Industry Arbitration Rules then obtaining, unless the parties mutually agree otherwise. In the event of a claim, Envirotest's Client will allow Envirotest and any other pertinent parties to inspect the claim prior to any repairs or waive the right to make the claim. Envirotest's Client agrees not to disturb or repair or have repaired anything which may constitute evidence relating to the complaint, except in the case of an emergency.

All appearances by Envirotest staff concerning this report, the property in question or for any other purpose shall be billed at the rate of \$200.00/hour.

If any part of this statement or report is not agreeable to you, please contact Envirotest at any time and we will endeavor to rectify issues with this report free of charge.